



(V1.00)



1.1	- 3 -
1.2	- 3 -
1.3	- 3 -
1.4	- 3 -
1.5	- 3 -
1.6	- 3 -
1.7	- 3 -
1.8	- 3 -
1.9	- 3 -

2.1	8
2.2	8
2.3	- 3 -
2.4	- 3 -
2.5	- 3 -
2.6	- 3 -
2.7	- 3 -
2.8	- 3 -

Resolver

s1

1

$$U_{R_1 R_3}(t) = U_{1m} (\sin \omega t) \quad 1$$

U_{1m}

ω

2

$$U_{S_1 S_3}(t) = U_{2m} (\sin \omega t + \alpha) \cos(\theta) \quad 2$$

$$U_{S_2 S_4}(t) = U_{2m} (\sin \omega t + \alpha) \sin(\theta) \quad 3$$

$U_{S_1 S_3}$

$U_{S_2 S_4}$

U_{2m}

ω

α

θ

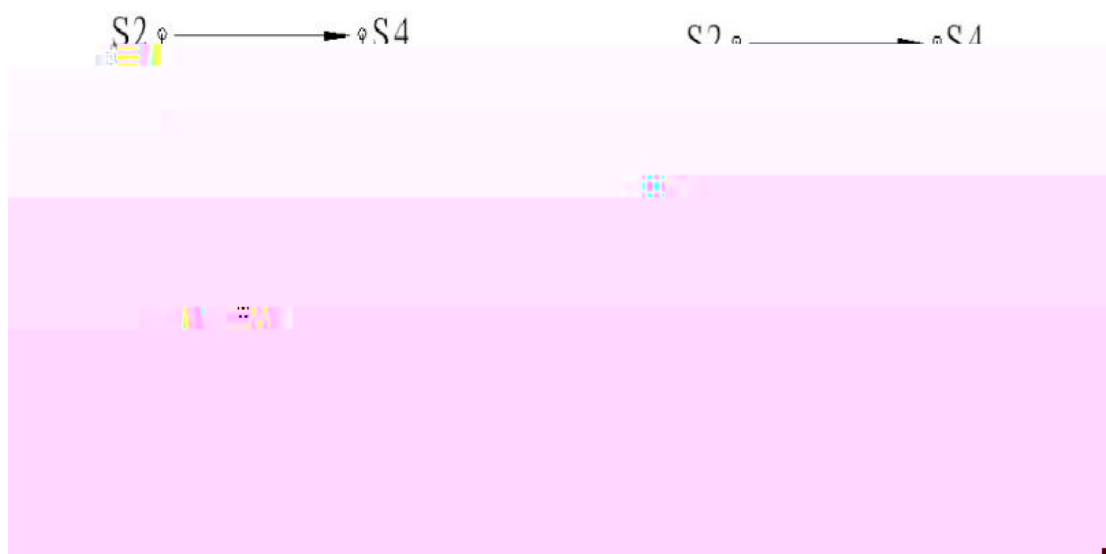


图 3、旋转变压器原理图

1

10V

400Hz

2kHz

10kHz

2

3

4

5

$3^\circ \quad 12^\circ$

6

$0^\circ \quad 90^\circ \quad 180^\circ \quad 270^\circ$

1

4

7

0°

8

1

0.02% 0.1%

2

2 '

10 '

3

±

60 °

4

5

2

表 2、旋转变压器的精度等级与对应误差值

	0	I	II	III
%	0.05	0.1	0.2	0.3
'	3	6	12	18
'	2	4	8	18
'	5	10	20	30

“ ” “ ”

1

2

3

4

5

6

7

1

- a)
- b)
- c)
- d)

2

- a)
- b)
- c)

3

- a)
- b)

4

- a)
- b)

RXMC-V100

Mbps

RS422/RS485

8 16 32 64

128

18AWG 0.75mm² 0.1Ω Φ7.5 12mm DB15 4Ω

表 1、DB15 孔座连接器管脚定义

1	CJ-COS-		8	JJ-SIN-	
2	CJ-SIN-		9	CJ-COS+	
4	EXC+		10	CJ-SIN+	
5	EXC-		14	JJ-COS+	
7	JJ-COS-		15	JJ-SIN+	

5VDC ± 5%

2m 18AWG 0.75mm²

RS422 DB9

表 2、DB9 孔座连接器管脚定义

1	TX+	RS422	
2	TX-	RS422	
3	RX-	RS422	
4	RX+	RS422	
5 6 7	GND		
8 9	5V	5V	

105mm × 86mm × 23mm

5VDC ± 5%

± 200mA

≤ 2W

5V

9000rpm 3

表 3、双通道旋变最大可跟踪机械角速度与精机磁极对数的关系

	rpm	
8	1125	
16	562.5	
32	281.25	
64	140.625	
128	70.3125	

1kHz

-40 +85

4

表 4、双通道旋转变压器精机磁极对数与分辨率的关系

	bit	1LSB"
8	19	2.47
16	20	1.24
32	21	0.62
64	22	0.31
128	23	0.16

RS422 RS485

3.75Mbps

8

1

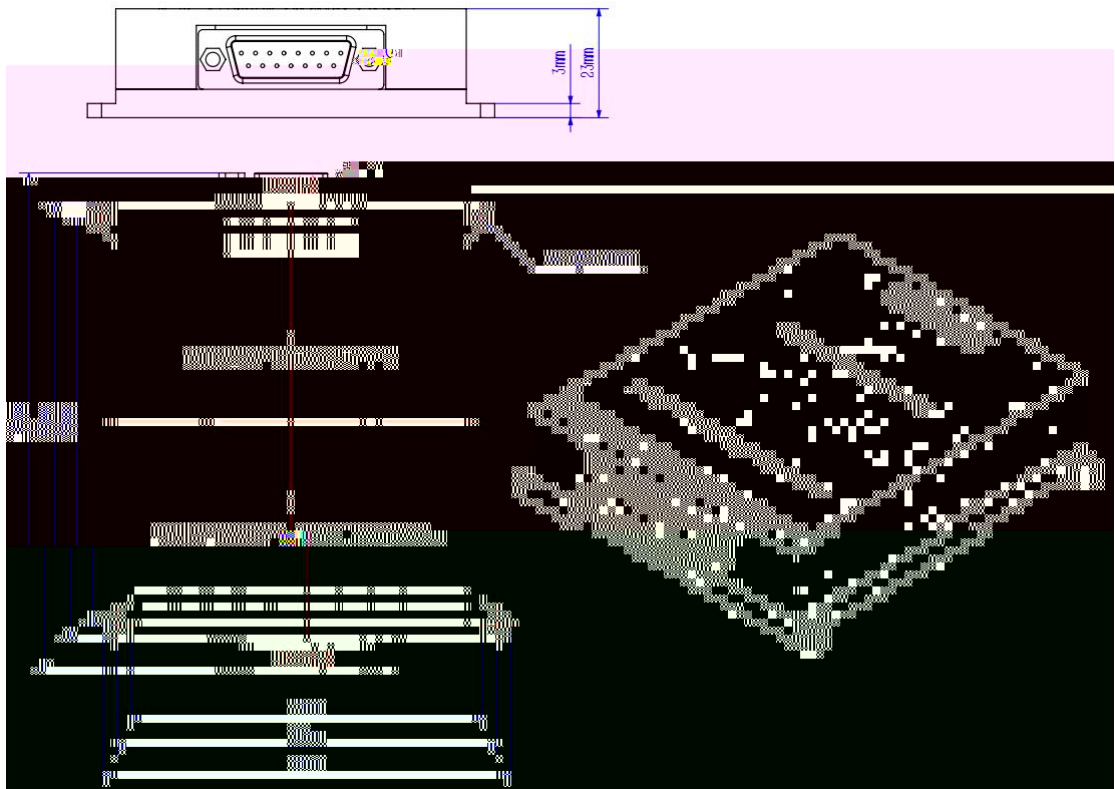


图 1、 双通道旋变解码器机械安装参数